

Aero Commander

the
tough
birds



Service change

SERVICE CHANGE 2006

DATE: September 8, 1967

TO: Owners of Aero Commander Model 200, Serial #251-383

SUBJECT: Visual inspection of nose gear bellcrank, part #64C140

The nose gear steering bellcrank part #64C140 which is attached to the nose gear strut and to which the nose gear steering cables attach, should be visually inspected for possible cracks in the welds at the base, and for cracks radiating from the hole through which the attaching bolt passes.

In the event cracks or other damage is detected in this bellcrank, it must be repaired before the next flight.

We further recommend that this inspection be incorporated into the 100-hour and annual inspection procedures.

Robert L. Frank
Manager
Parts & Service Operations